

Manufacturer:



Terazidere Mah.60.Yil Cad.No:5/3
 34035 Bayrampasa/ISTANBUL/TURKEY
 TEL: 0 212 501 48 63
 FAX: 0 212 501 48 83
 Email: opkoninfo@opkon.com.tr



MODEL OP-MD4

**DIGITAL DISPLAY
 FOR POTENTIOMETRIC
 SENSORS OR 0-5V INPUT**

**Ver 2.0E
 USER GUIDE**



WARNING!

READ CAREFULLY BEFORE POWER ON

1. Complete electrical connections according to the schematic at the third page.
2. Check Supply Voltage 220V (or 24V optional) AC, or DC, due to Specifications on the equipment.
3. Use only shielded cable for sensors.
4. Keep away the equipment from direct heat source.
5. MODEL OP-MD4 is not suitable for outdoor use.
6. Keep away the equipment from water or other liquid drains.
7. Do not open, modify or replace any component in the equipment, If any problem occurs please contact an authorised OPKON technical service or OPKON directly

ELECTRICAL SPECIFICATIONS:

Microcontroller based
 10 bit Analog/Digital converter
 Up to 200 kSPS
 Two calibration point

Power supply	:220V ± % 20 (or 24V optional),50 Hz
Power consumption	:<4 VA(protected by fuse 50mA)
Sensor supply voltage	:+5V or +12VDC(selectable by jumper)
Sensor supply current	:Max.100mA(no fuse)
Input	:Potentiometric or 0-5V DC


MECHANICAL SPECIFICATIONS:

Dimensions	:72x72x100 mm
Panel cut dimensions	:67x67mm
Body	:ABS plastic
Working temperature	:0-60 °C
Storage temperature	:-10°C ... +80°C
Humidity	:<%90 RH

PROGRAMMING MODEL-MD4

1) TWO POINT CALIBRATION

Lower Calibration Point :

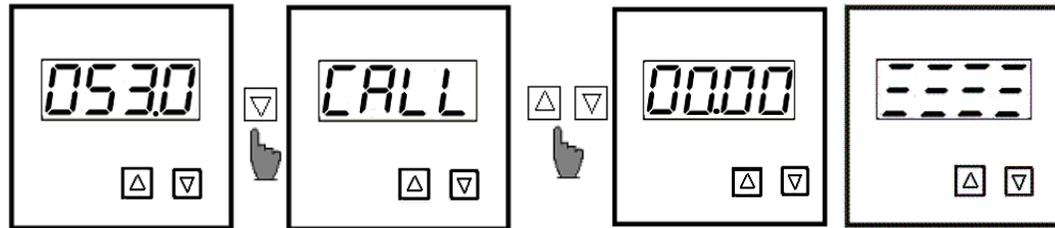


• Move the Sensor mechanically to the zero position.

1. **Press DOWN** button continuously, until the word CALL appears on the screen.
2. **Press UP / DOWN** to set the value on the screen zero or any value desired.
3. **Wait 2 second** without pressing any button, the last screen appears.

• After this, the equipment goes back to operation mode. So the *Lower Calibration Point* was defined..

Upper Calibration Point :

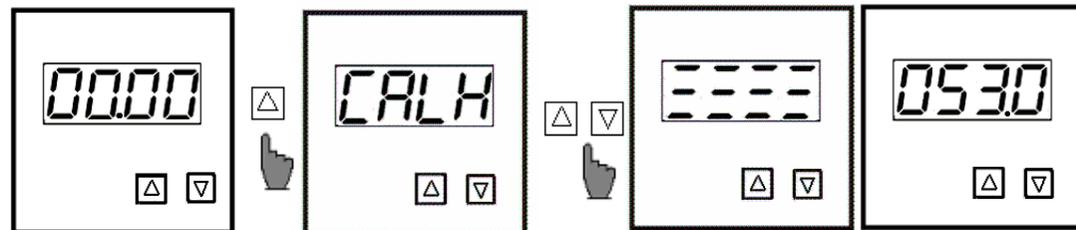


• Move the Sensor mechanically to the maximum position.

1. **Press UP** button continuously, until the word CALH appears on the screen.
2. **Press UP / DOWN** to set a desired value.
3. **Wait 2 second** without pressing any button, the last screen appears.

• After this, the equipment goes back to operation mode. So the *Upper Calibration Point* was defined.


2) SETTING THE DECIMAL POINT

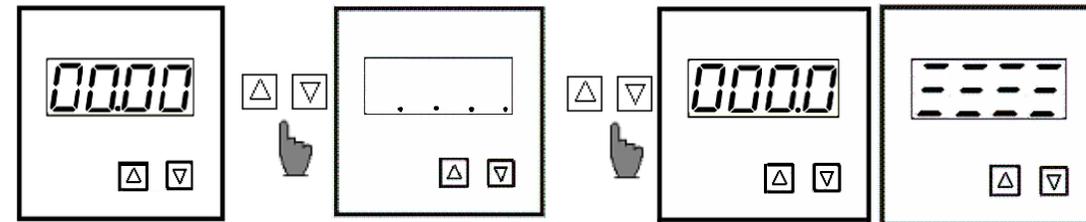

1. **Press UP/DOWN** button at the same time and continuously, until the second screen appears.
2. **Press UP/DOWN** buttons to select the decimal point.
3. **Wait 2 second** without pressing any button, the last screen appears.

• After this, the equipment goes back to operation mode. So the *Decimal Point* was defined.

ELECTRICAL CONNECTIONS

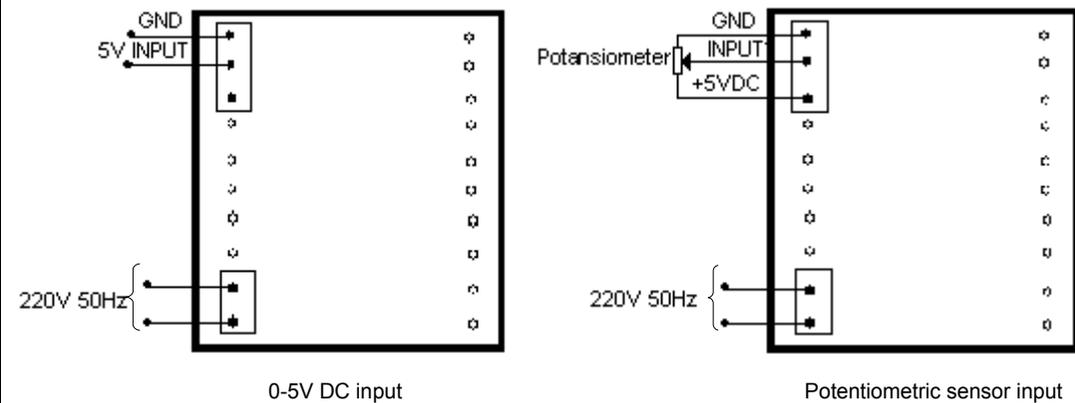

0-5V DC input

Potentiometric sensor input