


USB driver installation


User guide

USB Driver Installation

1. When the connection of USB Data Communication with the port succeeds, you will see the message **'Found New Hardware'** and **'Found New Hardware Wizard'** will be displayed on the screen.

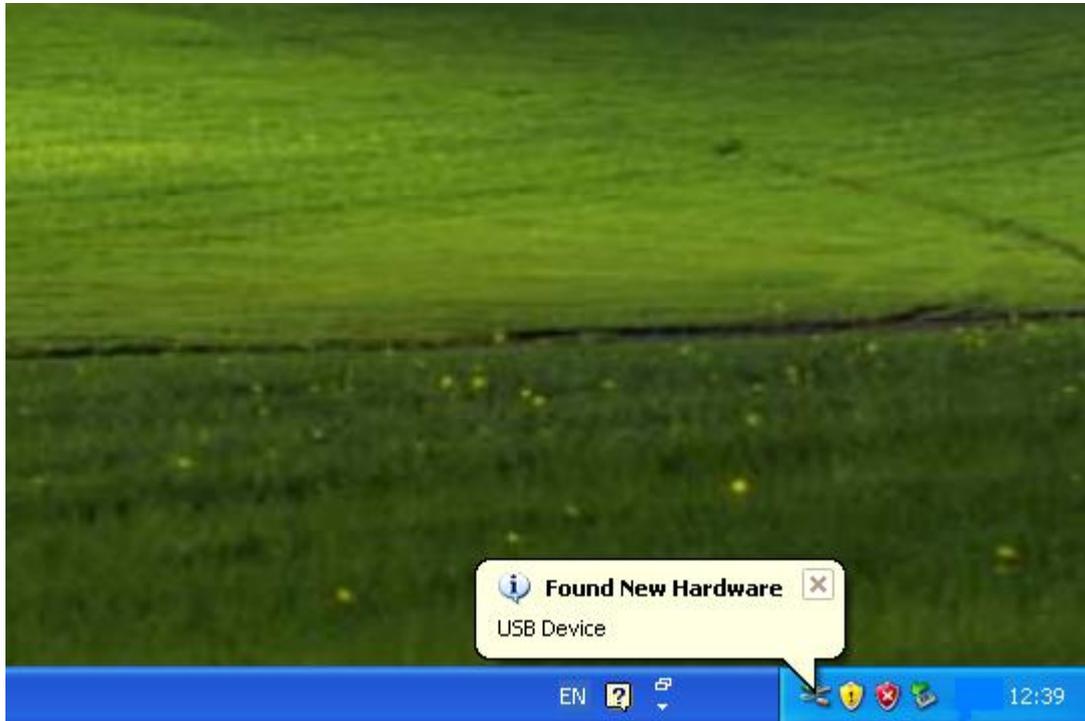

2. As in the figure above, select **'no, not this time'** and click **'Next'**.

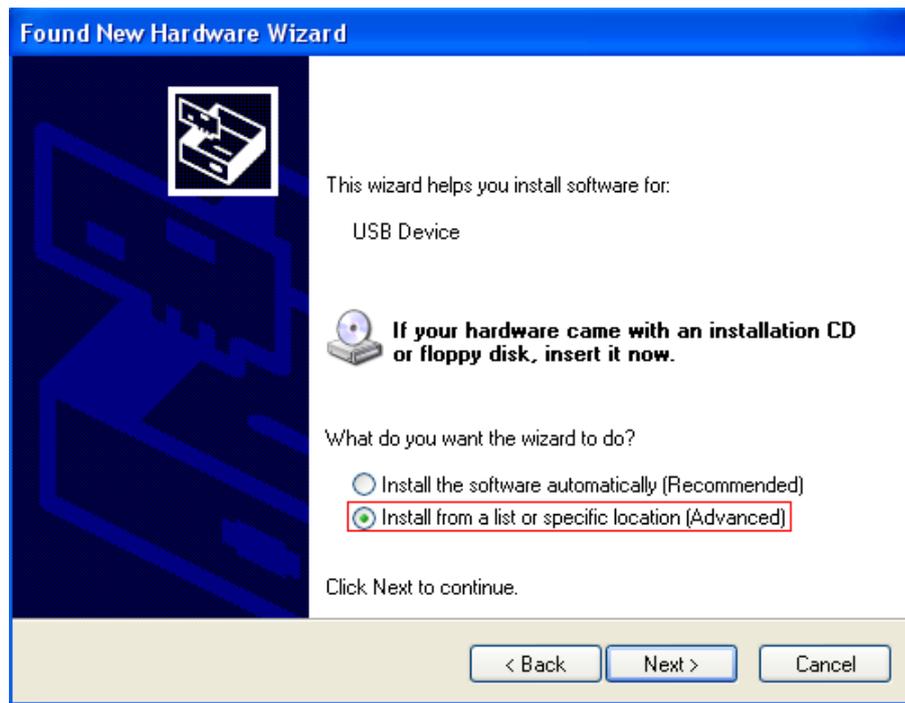


3. Select **'Install from a list or specific location (Advanced)'** and click **'Next'**.

There are two proceeding route to install it, **'Search for the best driver in these locations'** and **'Don't search, I will choose the driver to install'**.

※ The driver is included in the program folder(XDesignerPlus or XTOP-Designer) installed

▶ The route for **'Search for the best driver in these locations'**

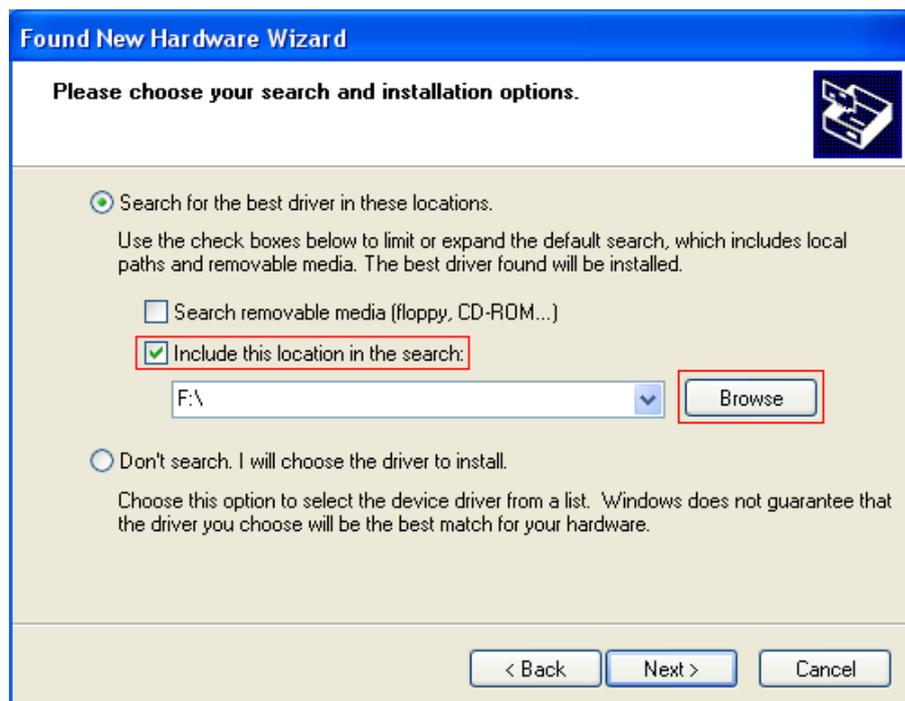


4. As in the figure above, check **'Include this location in the search'** and click **'Browse'**.



5. When **'Browse For Folder'** is displayed, select the folder which the driver file is located in and click **'OK'**. After that, click **'Next'** on the **'Found New Hardware Wizard'**.


The driver file location : Local Disk(C:) → Program Files → M2I Corp → XDesignerPlus → usb_driver)

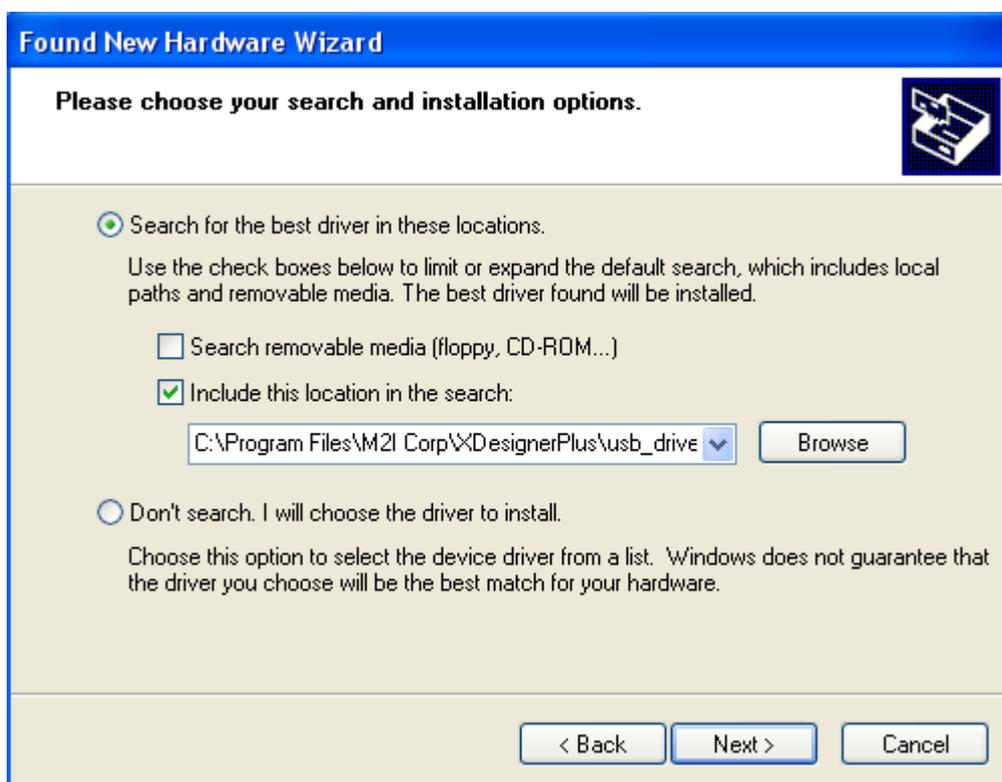

6. As in the figure above, searching the driver file is done, click **'Next'**.



7. During the progress, a caution will be displayed, as in the figure above. Click **Continue Anyway**.

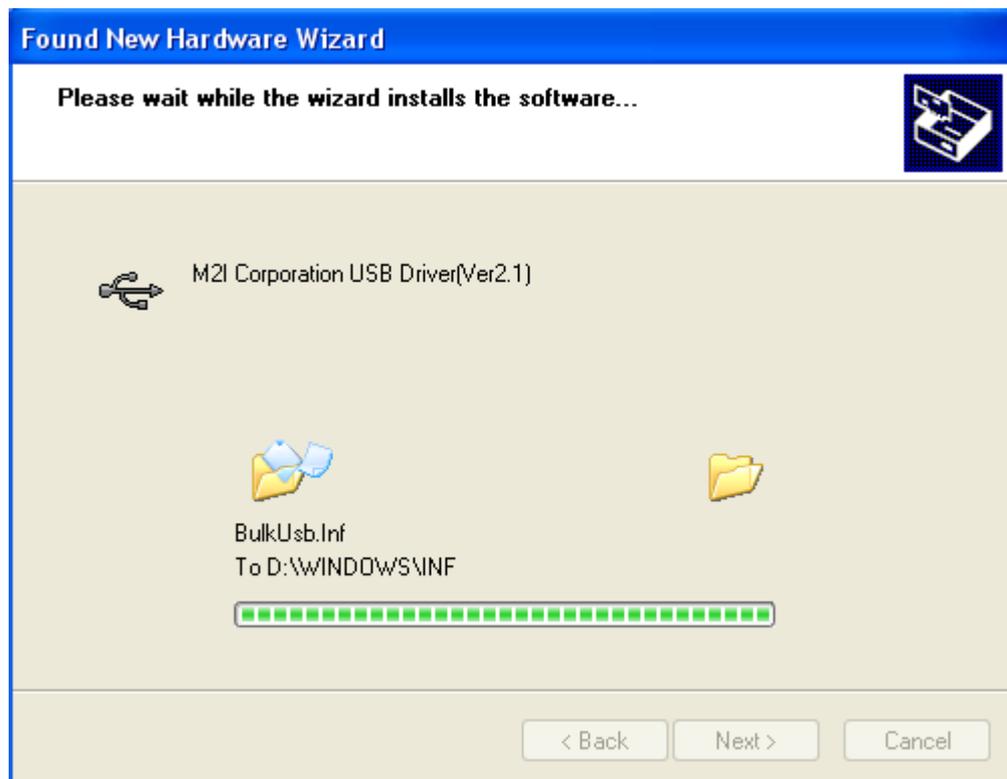


8. As the installation proceeds, a status progress bar displays.




9. Click **'Finish'** to close the wizard.

► The route for **'Don't search. I will choose the driver to install'**

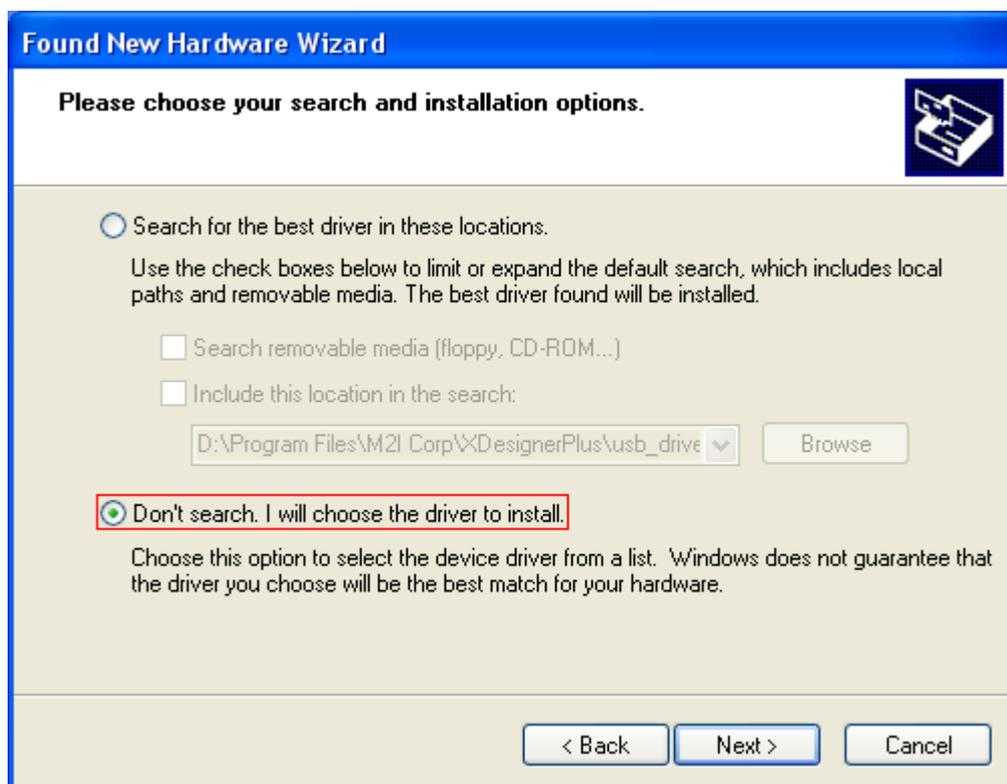


10. As in the figure above, select **'Don't search. I will choose the driver to install'** and click


'Next'.

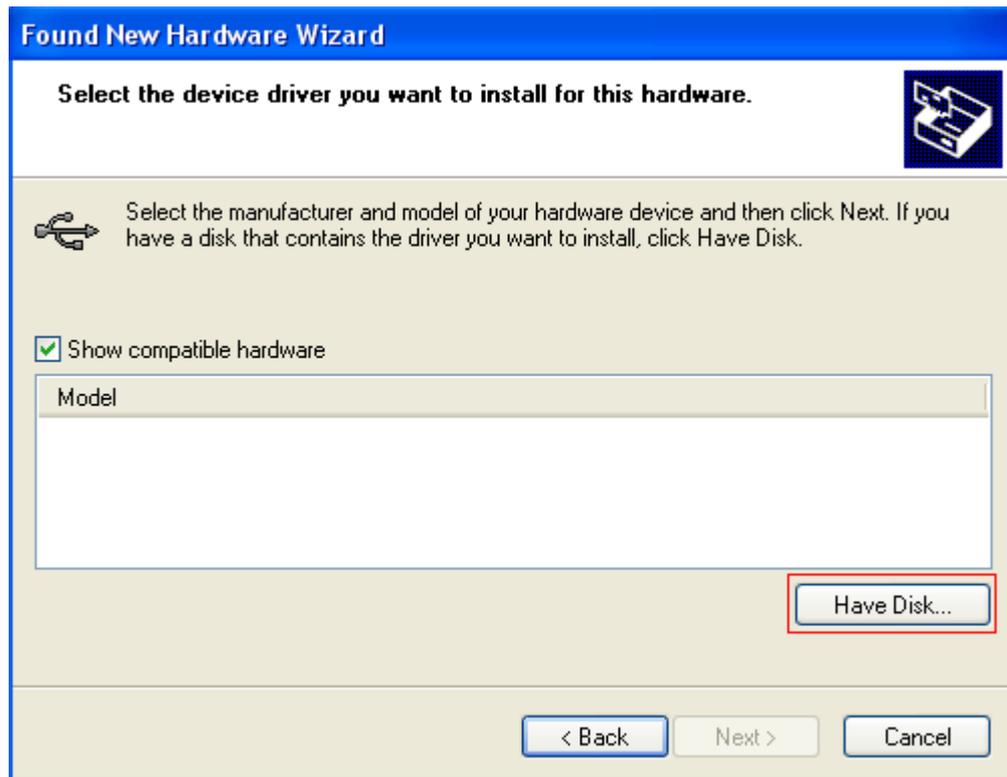


11. It displays no drivers, click 'Have Disk...'.

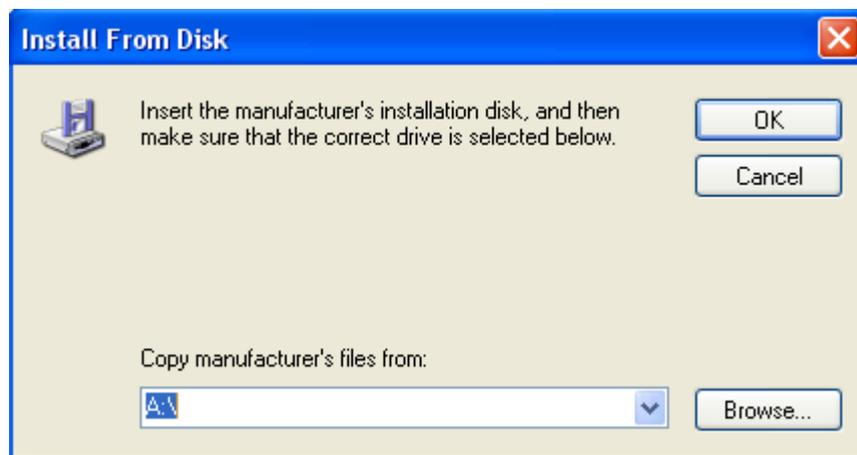

12. When 'Install From Disk' is displayed, click 'browse'.

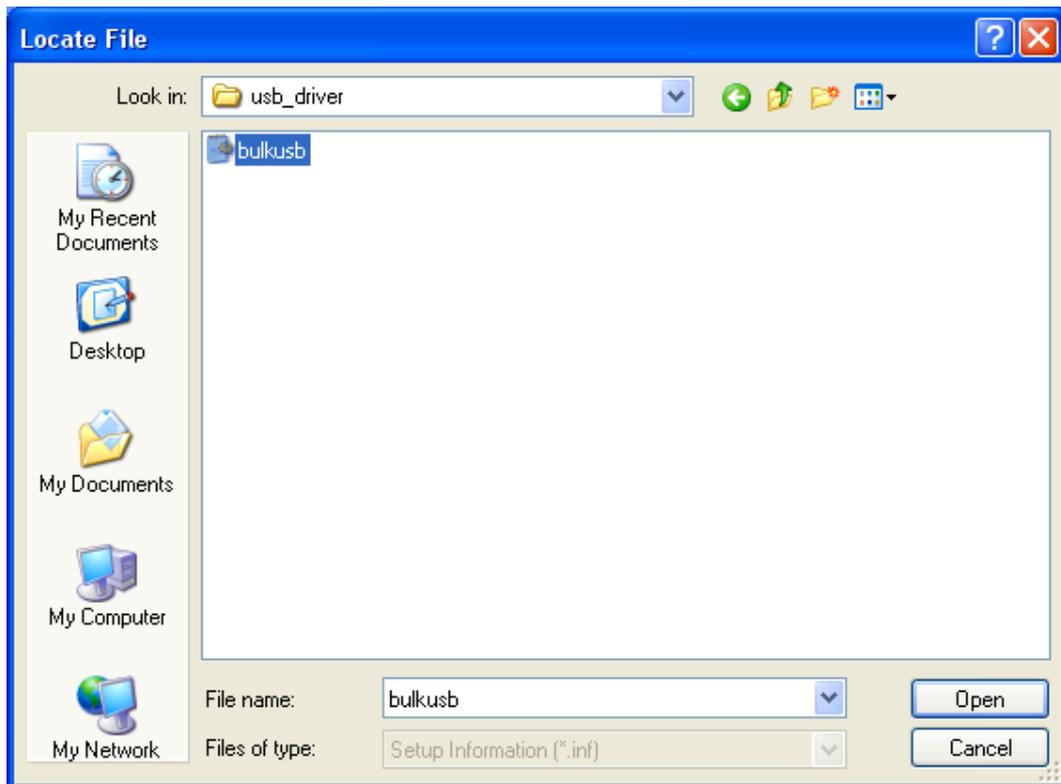


13. Select the folder which the driver file is located in and select the file and click **'Open'**.
The driver file location : Local Disk(C:) → Program Files → M2I Corp → XDesignerPlus
→ usb_driver)

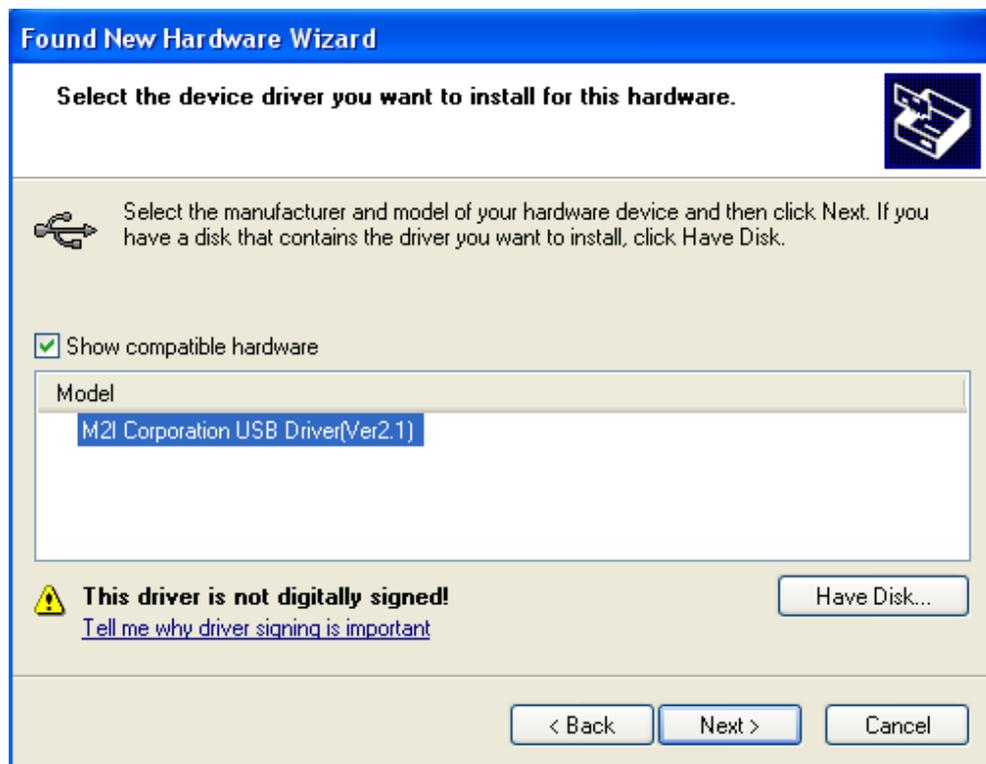


14. When **'M2I Corporation USB Driver'** is displayed, select the driver and click **'next'**.



- 15 During the progress, a caution will be displayed, as in the figure above. Click 'Continue Anyway'.

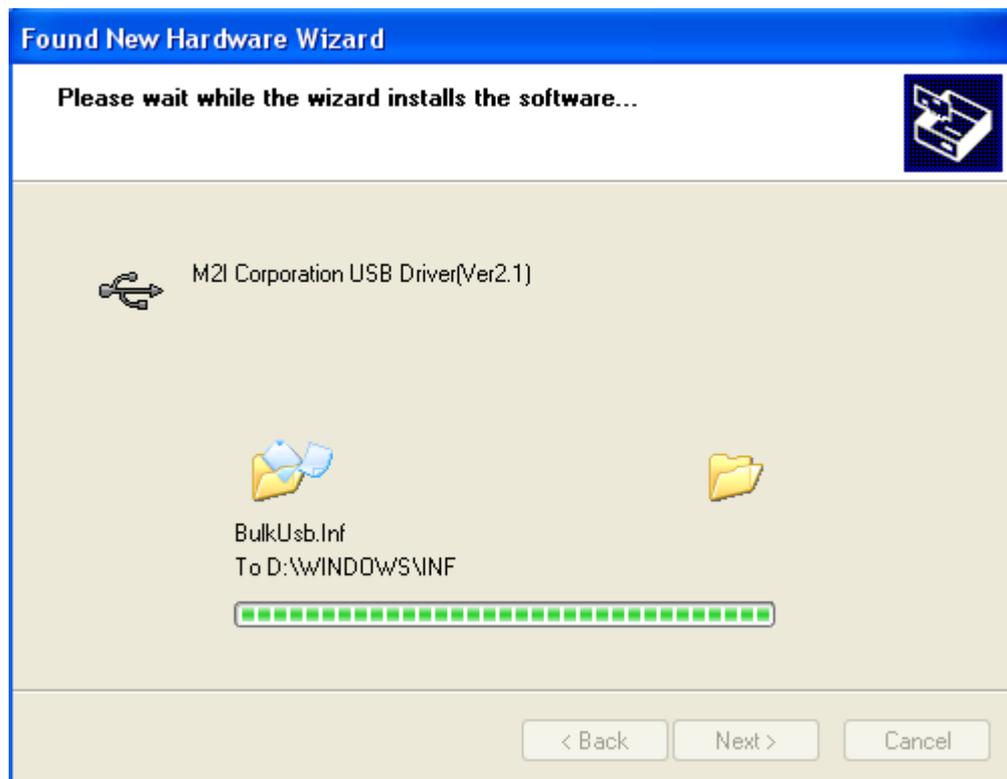

- 16 As the installation proceeds, a status progress bar displays.

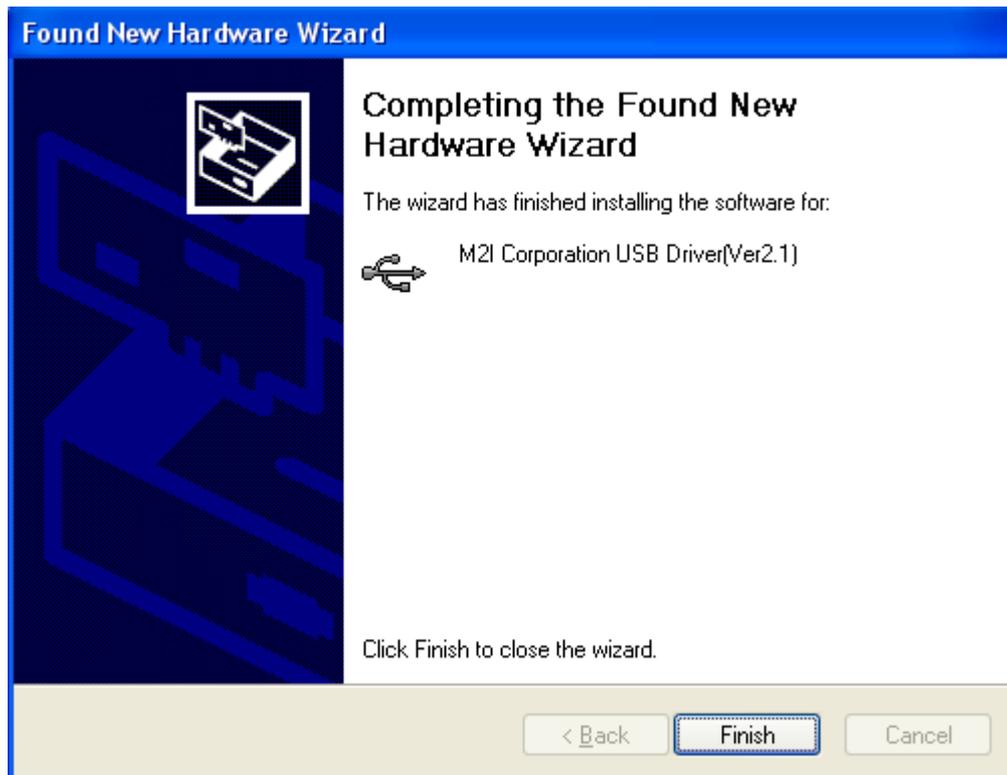


17 Click **'Finish'** to close the wizard.


Execute **'Device manager'** to check the driver has been installed successfully.




18. Click **'Start'** → **'Control Panel'** or **'Start'** → **'Option'** → **'Control Panel'**

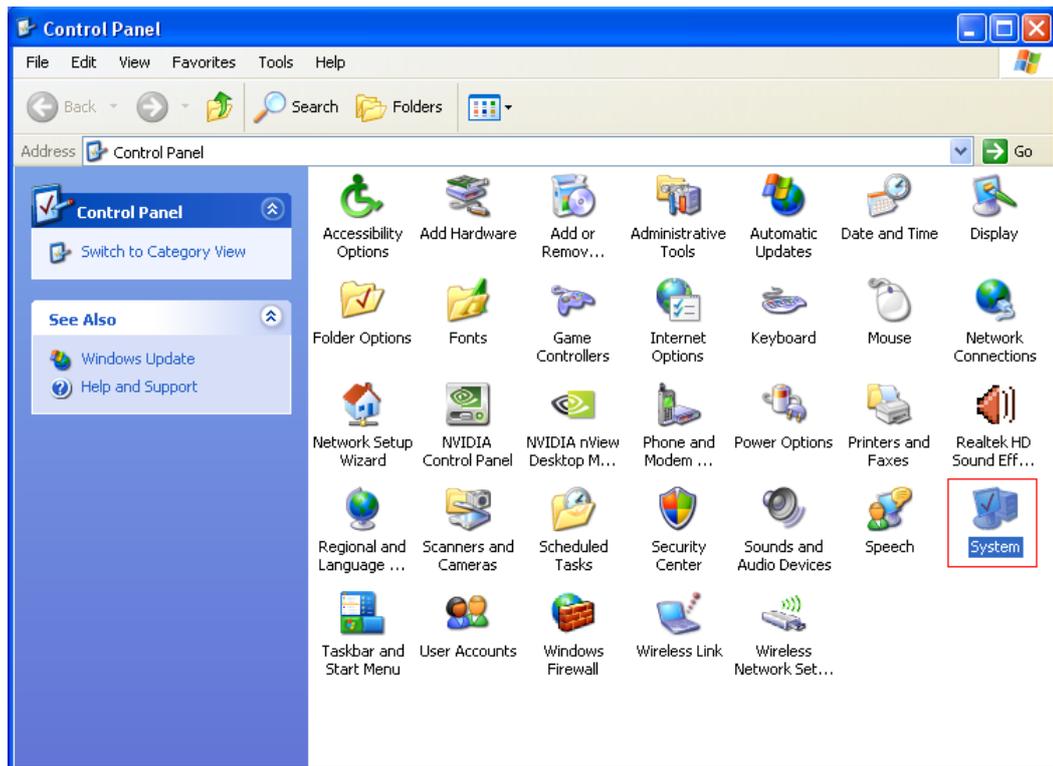

19. Double click **'System'**

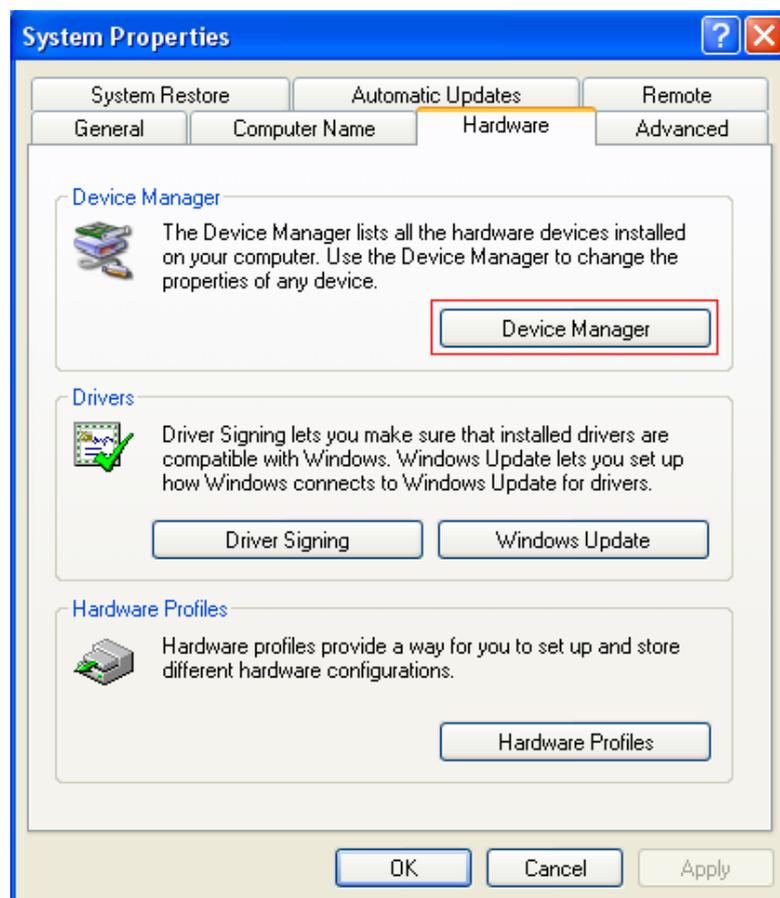


20. When **'System Properties'** displays, click **'Hardware'** tab and click **'Device manager'**.

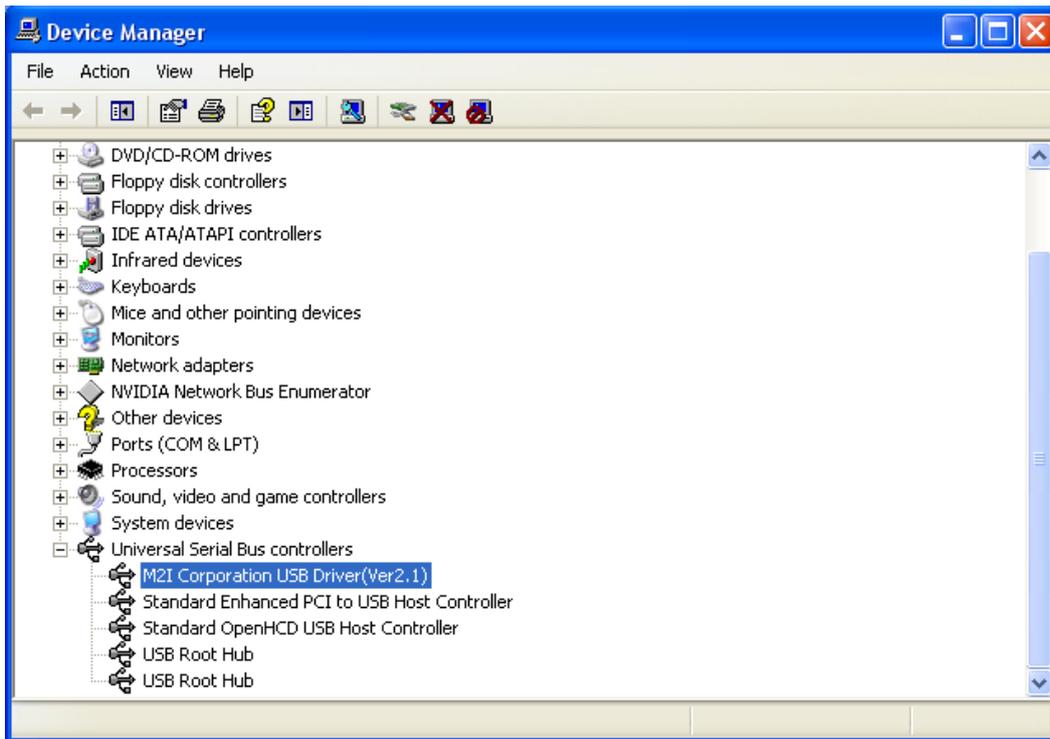

21. As in the figure above, if **'M2I Corporation USB Driver'** displays under **'Universal Serial Bus controller'**, the driver has been installed successfully.

※ **'M2I Corporation USB Driver'** is displayed, only when the USB cable is connected.

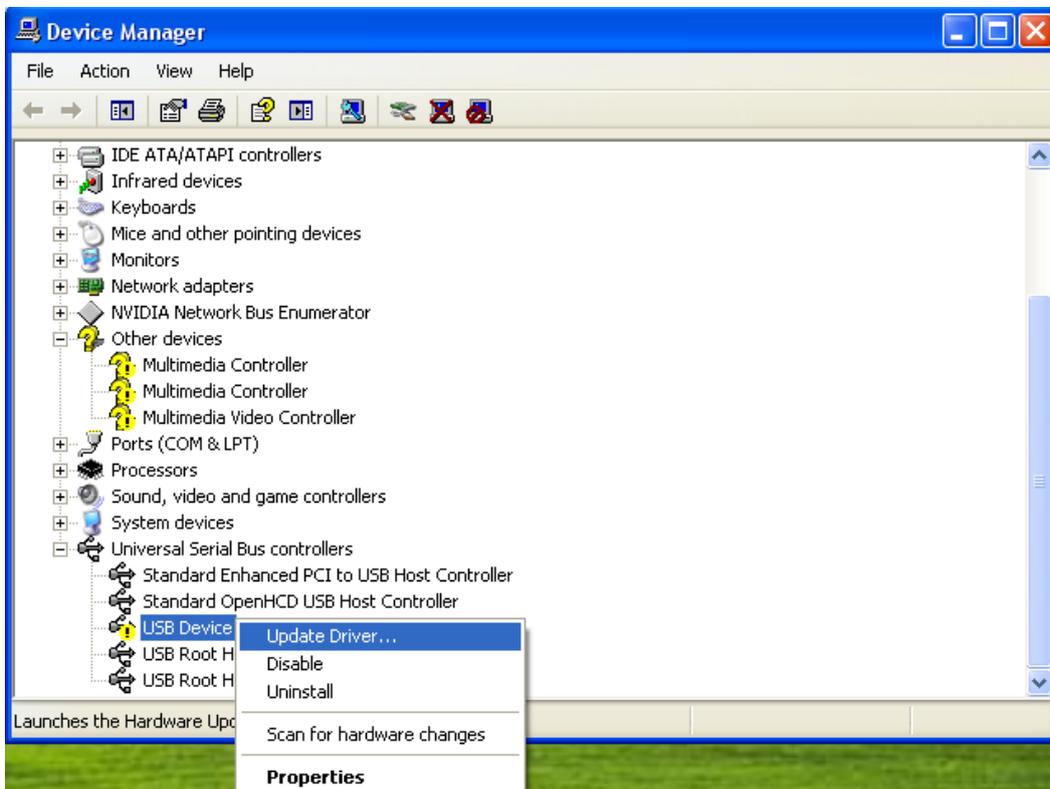

22. As in the figure above, if  displays beside **'USB Device'** or **'M2I Corporation USB Driver'**, try reconnecting the USB cable to the port or install the driver again by **'Update Driver...'**.